



Improved track control arm BMW E46

	SIDEM	APPLICATION	N° OE
21278 R	Track control arm	BMW (E46)	31 12 6 777 851 R
21279 R	Track control arm		31 12 6 774 820 R

PROBLEM




- Early wear of rubber bedding ball joint.
- Play on ball joint.



CAUSE

- Weak connection by rubber between inner and outer bushing.
- Damaged dustcover.

OE design

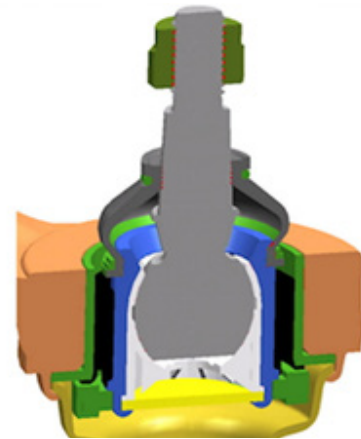

SOLUTION

- A new ball joint is progressed without the rubber core.
- A cover is added to protect the pin and the dustcover during transport and storage.

Sidem design

