



## Preload on BMW




	SIDEM	APPLICATION	N° OE
21570	track control arm	BMW 7-series E65/E66 TCA	31 12 6 774 831

### PROBLEM ❌

- Oil leak under front suspension and/or knocking noises at the front end of the car

### ❌ CAUSE

- The center part of the silent-block was tightened in a wrong angle, while the car was not resting on its wheels.

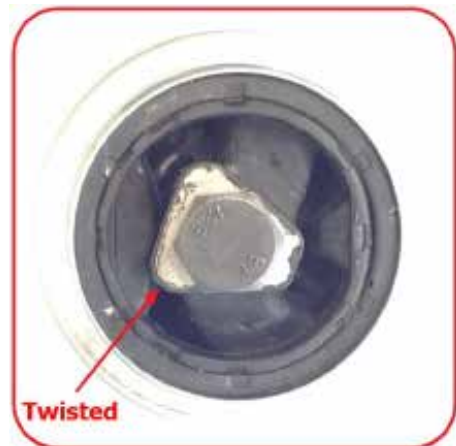

### ✅ SOLUTION

- Always make sure to tighten the silent-block bolts of traction arms when the suspension is in its normal operating situation.

