


R19 I-II (B/C53,L53_,D53_,S53_)

01/1988 - 06/1996

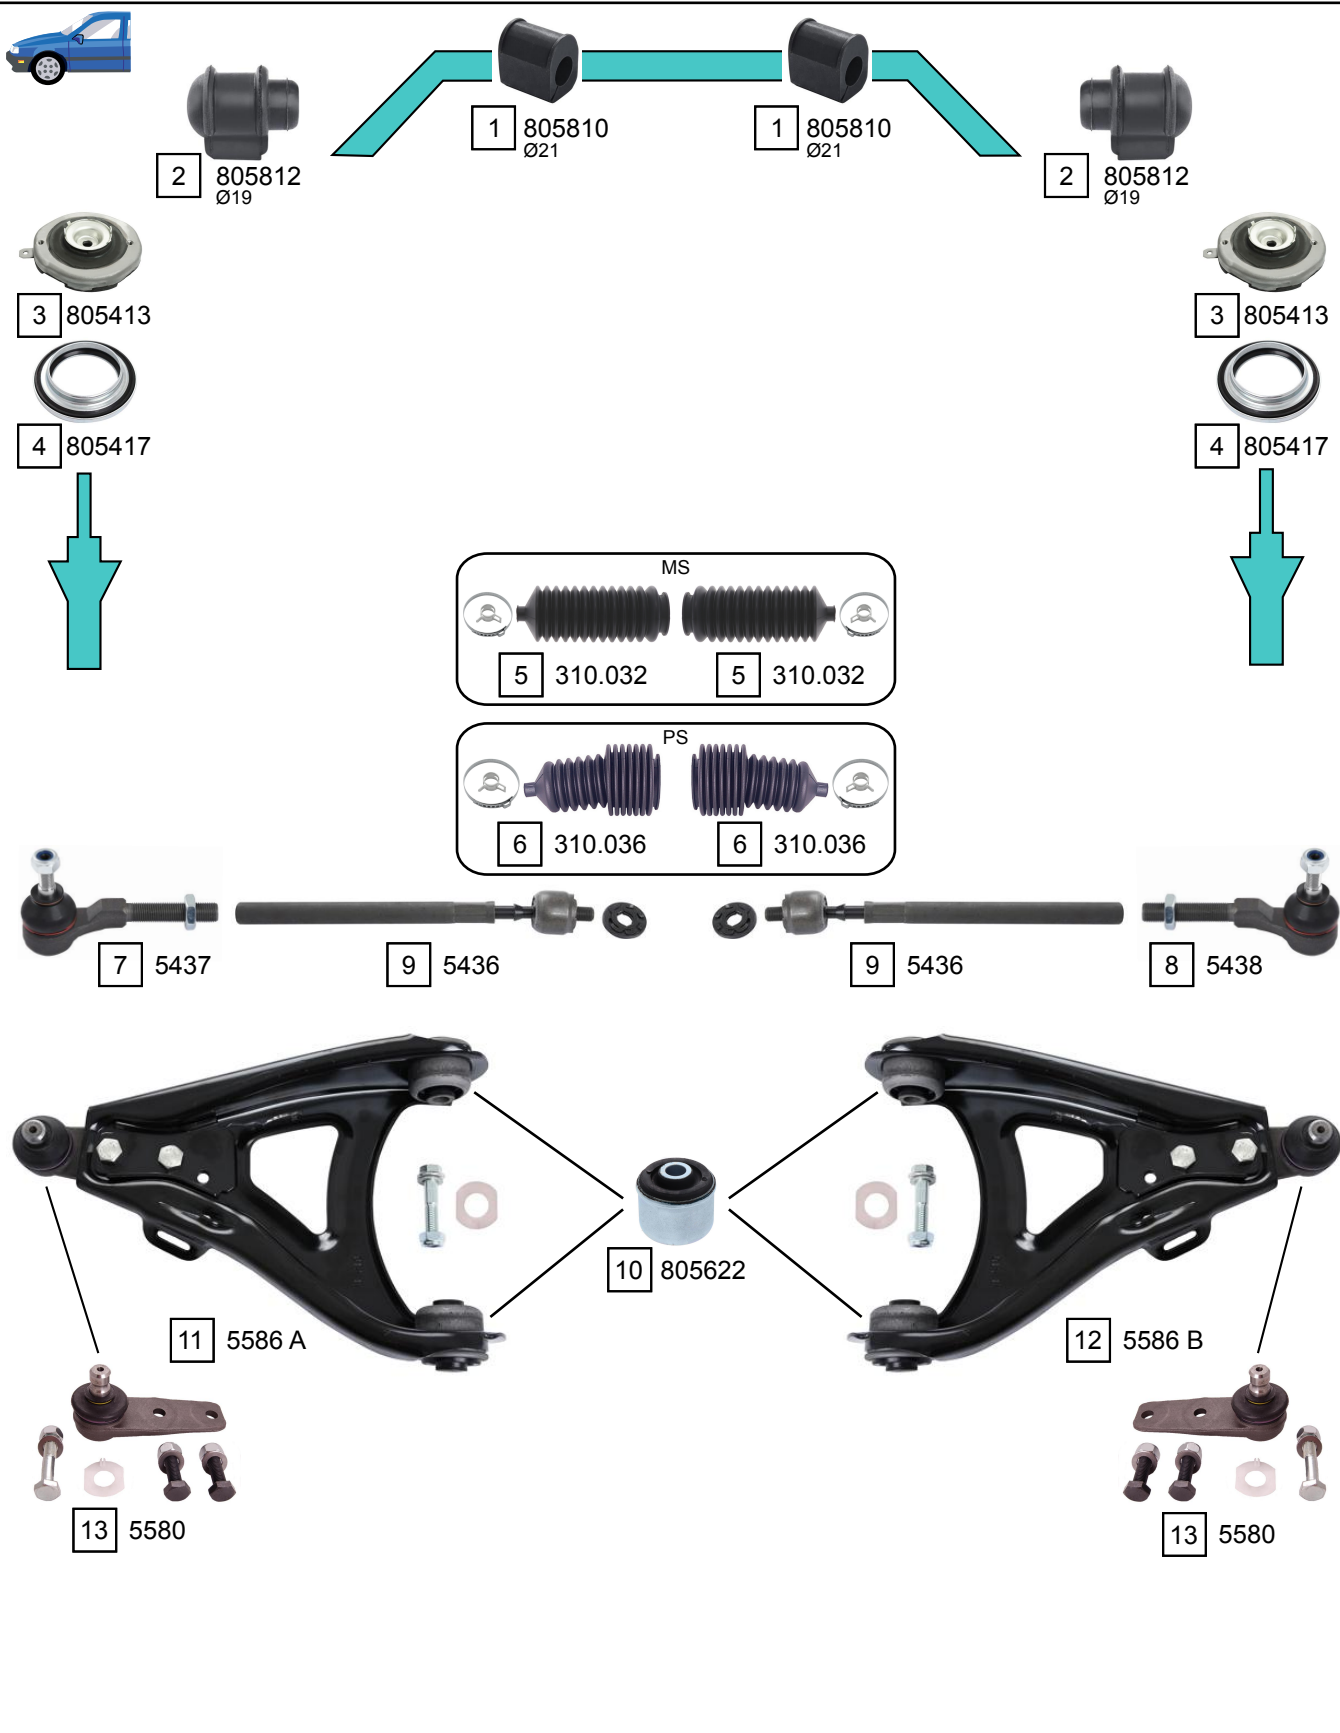

| Ref. | Sidem Ref. | Description | OE-number | Measures | Ref. | Sidem Ref. | Description | OE-number | Measures |
|------|------------|----------------------|---------------|---------------------|------|------------|---------------------|---------------|---------------------|
| 1 | 805810 | stabilizer mounting | 77 00 785 788 | di:21.5 | 8 | 5438 | tie rod end right | 60 00 030 048 | c:11.9 th:MM14X1.5R |
| 2 | 805812 | stabilizer link | 77 00 789 412 | L:56 | 9 | 5436 | axial joint | 77 01 465 917 | th:MM12X1R L:274 |
| 3 | 805413 | strut mount | 77 00 835 254 | di:14.5 do:98 L:57 | 10 | 805622 | silentblock for TCA | Part of | di:12.1 do:45.4 |
| 4 | 805417 | bearing | 77 00 777 654 | di:62 do:99.5 L:20 | 11 | 5586 A | TCA left wbj | 82 00 737 134 | c:16 |
| 5 | 310.032 | steering rack gaiter | 77 00 781 097 | D:30 d:10 L:158 | 12 | 5586 B | TCA right wbj | 82 00 737 135 | c:16 |
| 6 | 310.036 | steering rack gaiter | 77 01 469 617 | D:40 d:10 L:160 | 13 | 5580 | ball joint lower | 77 01 472 038 | c:16 |
| 7 | 5437 | tie rod end left | 60 00 030 047 | c:11.9 th:MM14X1.5R | | | | | |