


LEON (KL1)
LEON ST (KL8)

11/2019 ->
03/2020 ->

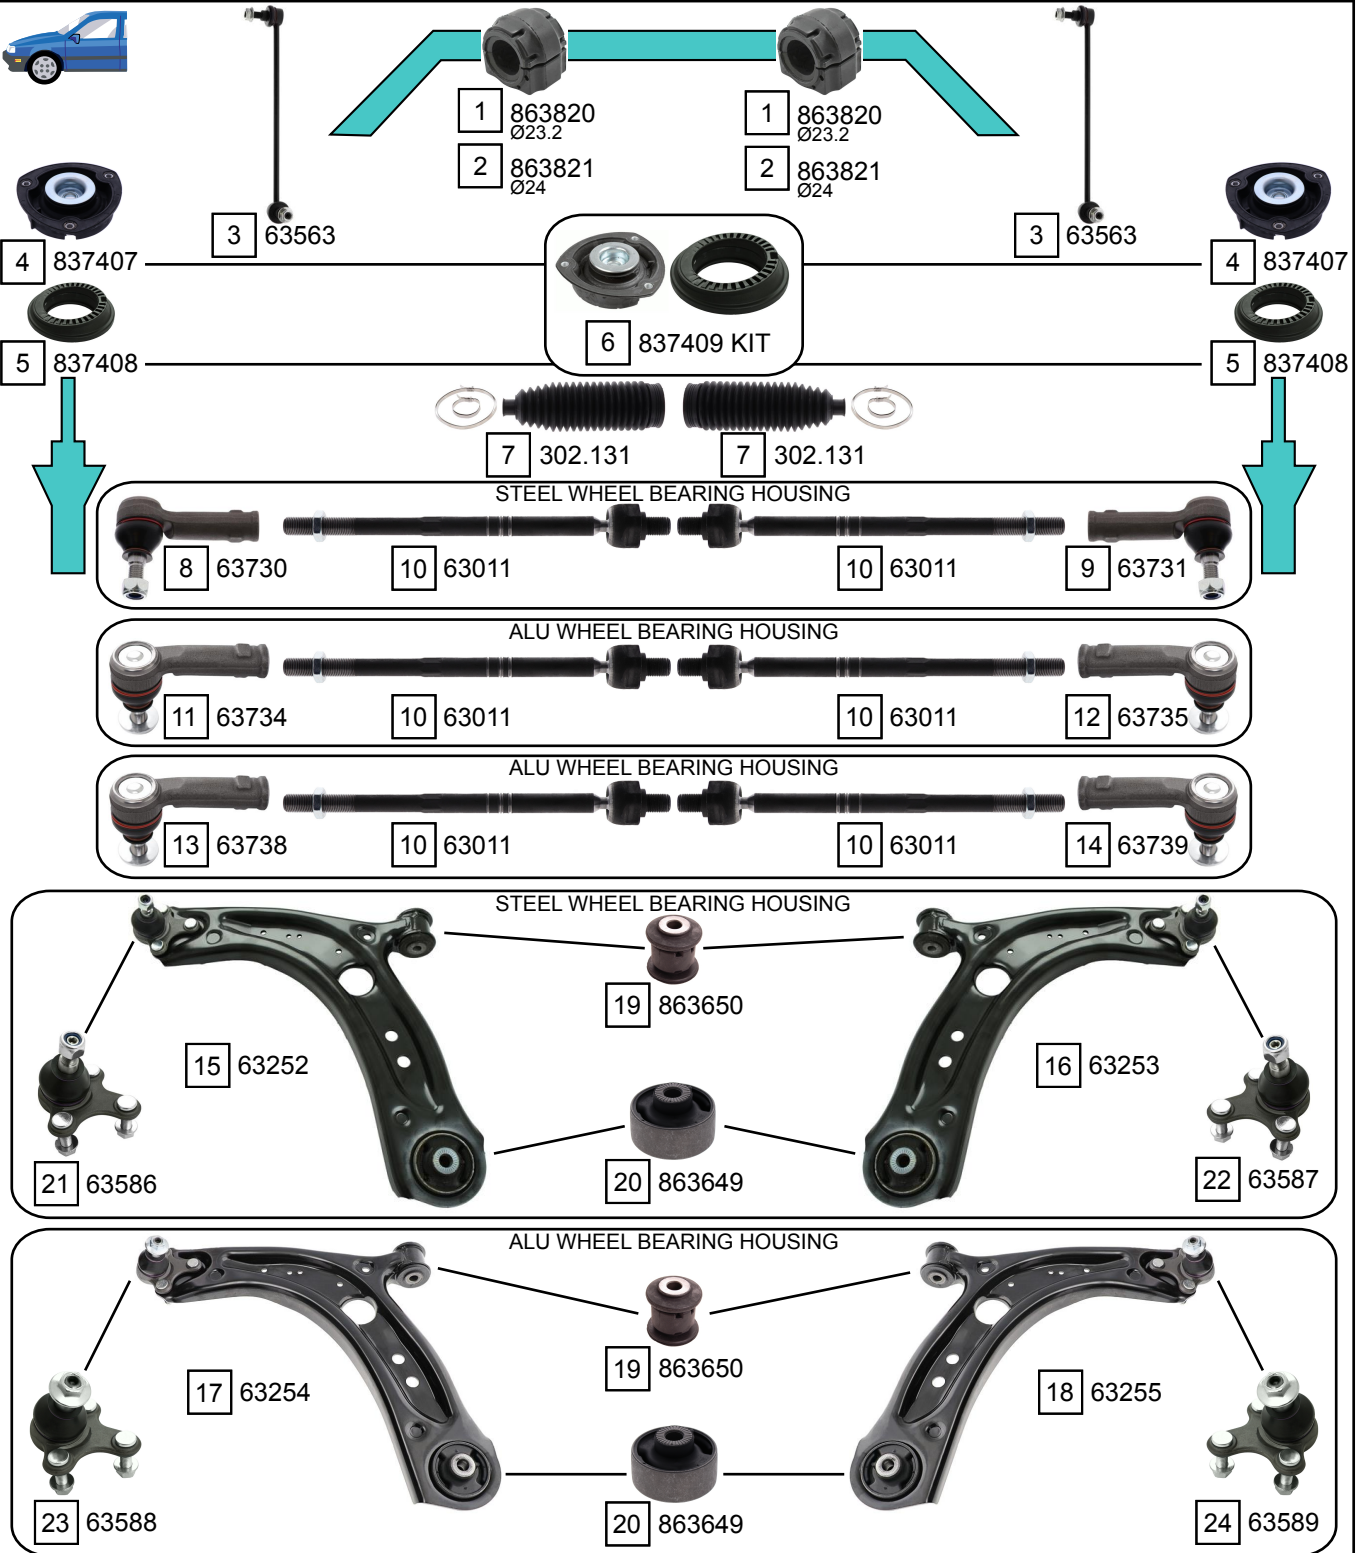

| Ref. | Sidem Ref. | Description | OE-number | Measures | Ref. | Sidem Ref. | Description | OE-number | Measures |
|------|------------|----------------------|------------------|----------------------|------|------------|---------------------|------------------|---------------------|
| 1 | 863820 | stabilizer mounting | Part of | di:23.2 | 13 | 63738 | tie rod end left | 5WA 423 811 E S2 | c:14.7 th:FM16X1.5R |
| 2 | 863821 | stabilizer mounting | Part of | di:24 | 14 | 63739 | tie rod end right | 5WA 423 812 E S2 | c:14.7 th:FM16X1.5R |
| 3 | 63563 | stabilizer link | 5Q0 411 315 A | L:335 | 15 | 63252 | TCA left wbj | 5WA 407 151 A S1 | c:15.4 |
| 4 | 837407 | strut mount | 5Q0 412 331 E | di:14.6 do:64.1 L:42 | 16 | 63253 | TCA right wbj | 5WA 407 152 A S1 | c:15.4 |
| 5 | 837408 | bearing | 5Q0 412 249 F | di:74 do:127 L:38.6 | 17 | 63254 | TCA left wbj | 5WA 407 151 A S2 | c:15.2 |
| 6 | 837409 KIT | strut mount kit | 5Q0 412 331 E S1 | di:15 do:127 | 18 | 63255 | TCA right wbj | 5WA 407 152 A S2 | c:15.2 |
| 7 | 302.131 | steering rack gaiter | 1K0 423 831 A | D:50 d:15 L:193 | 19 | 863650 | silentblock for TCA | 5Q0 407 182 A | di:12.1 do:40.1 |
| 8 | 63730 | tie rod end left | 1K0 423 811 J S1 | c:13.2 th:FM16x1.5R | 20 | 863649 | silentblock for TCA | 5Q0 407 183 E | di:13 do:65 |
| 9 | 63731 | tie rod end right | 1K0 423 812 J S1 | c:13.2 th:FM16x1.5R | 21 | 63586 | ball joint left | 1K0 407 365 C | c:15.4 |
| 10 | 63011 | axial joint | 5WA 423 810 C | th:MM16X1.5R L:310 | 22 | 63587 | ball joint right | 1K0 407 366 C | c:15.4 |
| 11 | 63734 | tie rod end left | 1K0 423 811 J S2 | c:13.2 th:FM16X1.5R | 23 | 63588 | ball joint left | 3C0 407 365 B | c:15.2 |
| 12 | 63735 | tie rod end right | 1K0 423 812 J S2 | c:13.2 th:FM16X1.5R | 24 | 63589 | ball joint right | 3C0 407 366 B | c:15.2 |