


OCTAVIA IV (NX3)
OCTAVIA IV COMBI (NX5)

01/2020 ->
11/2019 ->

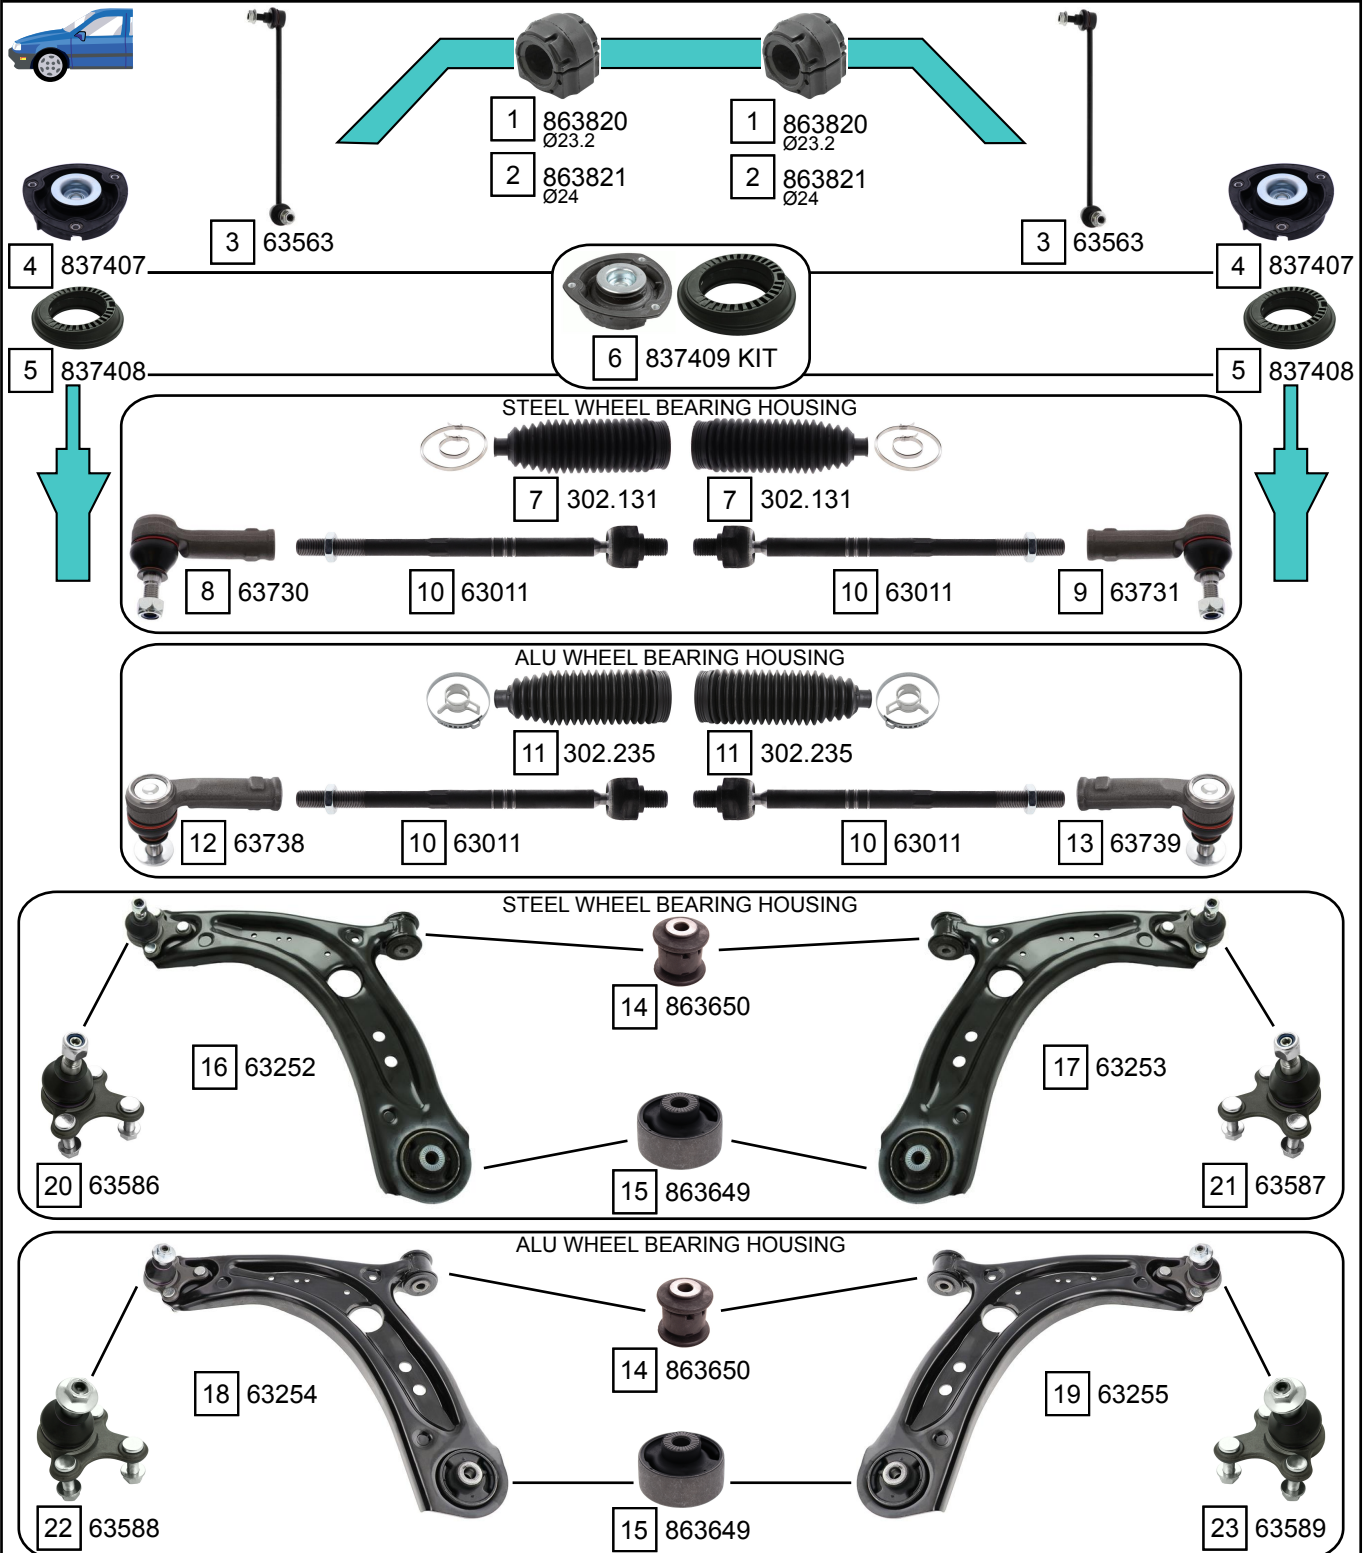

Ref.	Sidem Ref.	Description	OE-number	Measures	Ref.	Sidem Ref.	Description	OE-number	Measures
1	863820	stabilizer mounting	Part of	di:23.2	13	63739	tie rod end right	5WA 423 812 E S2	c:14.7 th:FM16X1.5R
2	863821	stabilizer mounting	Part of	di:24	14	863650	silentblock for TCA	5Q0 407 182 A	di:12.1 do:40.1
3	63563	stabilizer link	5Q0 411 315 A	L:335	15	863649	silentblock for TCA	5Q0 407 183 E	di:13 do:65
4	837407	strut mount	5Q0 412 331 E	di:14.6 do:64.1 L:42	16	63252	TCA left wbj	5WA 407 151 A S1	c:15.4
5	837408	bearing	5Q0 412 249 F	di:74 do:127 L:38.6	17	63253	TCA right wbj	5WA 407 152 A S1	c:15.4
6	837409 KIT	strut mount kit	5Q0 412 331 E S1	di:15 do:127	18	63254	TCA left wbj	5WA 407 151 A S2	c:15.2
7	302.131	steering rack gaiter	1K0 423 831 A	D:50 d:15 L:193	19	63255	TCA right wbj	5WA 407 152 A S2	c:15.2
8	63730	tie rod end left	1K0 423 811 J S1	c:13.2 th:FM16x1.5R	20	63586	ball joint left	1K0 407 365 C	c:15.4
9	63731	tie rod end right	1K0 423 812 J S1	c:13.2 th:FM16x1.5R	21	63587	ball joint right	1K0 407 366 C	c:15.4
10	63011	axial joint	5WA 423 810 C	th:MM16X1.5R L:310	22	63588	ball joint left	3C0 407 365 B	c:15.2
11	302.235	steering rack gaiter	5Q0 423 831	D:54 d:16 L:191	23	63589	ball joint right	3C0 407 366 B	c:15.2
12	63738	tie rod end left	5WA 423 811 E S2	c:14.7 th:FM16X1.5R					